Safety Data Sheet


* Trusted Quality Since 1921 *

www.rustoleum.com

1. Identification			
Product Name:	WDCARE HP 4PK VARA INT OIL BS SATN275VOC	Revision Date:	11/23/2015
Product Identifier:	242178H	Supercedes Date:	10/30/2015
Product Use/Class:	Topcoat/ Oil Based Varathane		
Supplier:	Rust-Oleum Corporation 11 Hawthorn Parkway Vernon Hills, IL 60061 USA	Manufacturer:	Rust-Oleum Corporation 11 Hawthorn Parkway Vernon Hills, IL 60061 USA
Preparer:	Regulatory Department		
Emergency Telephone:	24 Hour Hotline: 847-367-7700		

2. Hazard Identification

Classification

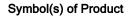



Signal Word Danger

GHS HAZARD STATEMENTS

Carcinogenicity, category 1B	H350	May cause cancer.		
Eye Irritation, category 2	H319	Causes serious eye irritation.		
Flammable Liquid, category 3	H226	Flammable liquid and vapor.		
Germ Cell Mutagenicity, category 1B	H340	May cause genetic defects.		
STOT, repeated exposure, category 1	H372	Causes damage to organs.		
STOT, single exposure, category 3, RTI	H335	May cause respiratory irritation.		
Skin Irritation, category 2	H315	Causes skin irritation.		
Skin Sensitizer, category 1	H317	May cause an allergic skin reaction.		
GHS LABEL PRECAUTIONARY STATE	MENTS			
P201	Obtain spec	ial instructions before use.		
P210	Keep away from heat, hot surfaces, sparks, open flames and other ignition sources. NO SMOKING.			
P260	Do not breathe dust, fumes, gases, mists, vapors, or spray.			
P280	Wear protective gloves/protective clothing/eye protection/face protection.			
P281	Use persona	al protective equipment as required.		
P302+P352	IF ON SKIN	: Wash with plenty of soap and water.		
P305+P351+P338	IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing.			
P308+P313	IF exposed	or concerned: Get medical advice/attention.		
P312	Call a POIS	ON CENTER or doctor/physician if you feel unwell.		

P333+P313	If skin irritation or rash occurs: Get medical advice/attention.
P337+P313	If eye irritation persists: Get medical advice/attention.
P362	Take off contaminated clothing.
P403+P233	Store in a well-ventilated place. Keep container tightly closed.
GHS SDS PRECAUTIONARY STATEME	ENTS
P240	Ground/bond container and receiving equipment.
P241	Use explosion-proof electrical/ventilating/lighting/equipment.
P242	Use only non-sparking tools.
P243	Take precautionary measures against static discharge.
P270	Do not eat, drink or smoke when using this product.
P363	Wash contaminated clothing before reuse.

3. Composition/Information On Ingredients

HAZARDOUS SUBSTANCES

Chemical Name	CAS-No.	<u>Wt.%</u> Range	GHS Symbols	GHS Statements
1-Chloro-4-(Trifluoromethyl)Benzene	98-56-6	25-50	GHS07	H315-319-335
Naphtha, Petroleum, Hydrotreated Light	64742-49-0	2.5-10	GHS08	H304-340-350
Mineral Spirits	64742-88-7	2.5-10	GHS08	H304-372
Stoddard Solvent	8052-41-3	1.0-2.5	GHS08	H304-372
Methyl Ethyl Ketoxime	96-29-7	0.1-1.0	GHS05-GHS06	H302-312-317-318-331
Ethylbenzene	100-41-4	0.1-1.0	GHS02-GHS07- GHS08	H225-304-332-373

4. First-aid Measures

FIRST AID - EYE CONTACT: Immediately flush eyes with plenty of water for at least 15 minutes holding eyelids open. Get medical attention. Do NOT allow rubbing of eyes or keeping eyes closed.

FIRST AID - SKIN CONTACT: Wash skin with soap and water. Remove contaminated clothing. Get medical attention if irritation develops or persists.

FIRST AID - INHALATION: Remove to fresh air. If not breathing, give artificial respiration. If breathing is difficult, give oxygen. Get immediate medical attention. Do NOT use mouth-to-mouth resuscitation. If you experience difficulty in breathing, leave the area to obtain fresh air. If continued difficulty is experienced, get medical assistance immediately.

FIRST AID - INGESTION: If swallowed, rinse mouth with water. If feeling unwell, get medical attention. Swallowing less than an ounce will not cause significant harm. For larger amounts, do not induce vomiting, but give one or two glasses of water to drink and get medical attention. Aspiration hazard: Do not induce vomiting or give anything by mouth because this material can enter the lungs and cause severe lung damage. Get immediate medical attention.

5. Fire-fighting Measures

EXTINGUISHING MEDIA: Alcohol Film Forming Foam, Carbon Dioxide, Dry Chemical, Water Fog

UNUSUAL FIRE AND EXPLOSION HAZARDS: Keep containers tightly closed. FLASH POINT IS TESTED TO BE GREATER THAN 200 DEGREES F. No unusual fire or explosion hazards noted.

SPECIAL FIREFIGHTING PROCEDURES: Water may be used to cool closed containers to prevent pressure buildup and possible autoignition or explosion. Water may be used to cool closed containers to prevent buildup of steam. If water is used, fog nozzles are preferred. Evacuate area and fight fire from a safe distance.

6. Accidental Release Measures

STEPS TO BE TAKEN IF MATERIAL IS RELEASED OR SPILLED: If spilled, contain spilled material and remove with inert absorbent. Dispose of contaminated absorbent, container, and unused contents in accordance with local, state, and federal regulations. Do not incinerate closed containersContain spilled liquid with sand or earth. DO NOT use combustible materials such as sawdust. Dispose of according to local, state (provincial) and federal regulations. Do not incinerate closed containers.

7. Handling and Storage

HANDLING: Wash thoroughly after handling. Wash hands before eating. Remove contaminated clothing and launder before reuse. Use only with adequate ventilation. Follow all MSDS/label precautions even after container is emptied because it may retain product residues. Avoid breathing fumes, vapors, or mist. Avoid contact with eyes, skin and clothing. Avoid contact with eyes.
STORAGE: Store in a dry, well ventilated place. Keep container tightly closed when not in use. Keep containers tightly closed. Isolate from heat, electrical equipment, sparks and open flame. Keep away from heat, sparks, flame and sources of ignition. Keep container closed when not in use.

8. Exposure Controls/Personal Protection

Chemical Name	CAS-No.	Weight % Less Than	ACGIH TLV- TWA	ACGIH TLV- STEL	OSHA PEL-TWA	OSHA PEL- CEILING
1-Chloro-4-(Trifluoromethyl) Benzene	98-56-6	40.0	N.E.	N.E.	N.E.	N.E.
Naphtha, Petroleum, Hydrotreated Light	64742-49-0	10.0	N.E.	N.E.	N.E.	N.E.
Mineral Spirits	64742-88-7	10.0	N.E.	N.E.	N.E.	N.E.
Stoddard Solvent	8052-41-3	5.0	100 ppm	N.E.	500 ppm	N.E.
Methyl Ethyl Ketoxime	96-29-7	1.0	10 ppm	N.E.	N.E.	N.E.
Ethylbenzene	100-41-4	1.0	20 ppm	N.E.	100 ppm	N.E.

PERSONAL PROTECTION

ENGINEERING CONTROLS: Use process enclosures, local exhaust ventilation, or other engineering controls to control airborne levels below recommended exposure limits. Prevent build-up of vapors by opening all doors and windows to achieve cross-ventilation.

RESPIRATORY PROTECTION: A respiratory protection program that meets OSHA 1910.134 and ANSI Z88.2 requirements must be followed whenever workplace conditions warrant a respirator's use. A NIOSH/MSHA approved air purifying respirator with an organic vapor cartridge or canister may be permissible under certain circumstances where airborne concentrations are expected to exceed exposure limits.

Protection provided by air purifying respirators is limited. Use a positive pressure air supplied respirator if there is any potential for an uncontrolled release, exposure levels are not known, or in any other circumstances where air purifying respirators may not provide adequate protection.

SKIN PROTECTION: Use gloves to prevent prolonged skin contact. Use impervious gloves to prevent skin contact and absorption of this material through the skin. Nitrile or Neoprene gloves may afford adequate skin protection.

EYE PROTECTION: Use safety eyewear designed to protect against splash of liquids.

OTHER PROTECTIVE EQUIPMENT: Refer to safety supervisor or industrial hygienist for further guidance regarding types of personal protective equipment and their applications. Refer to safety supervisor or industrial hygienist for further information regarding personal protective equipment and its application.

HYGIENIC PRACTICES: Wash thoroughly with soap and water before eating, drinking or smoking. Remove contaminated clothing immediately and launder before reuse.

9. Physical and Chemical Properties

Appearance:	Liquid	Physical State:	Liquid
Odor:	Solvent Like	Odor Threshold:	N.E.
Relative Density:	1.077	pH:	N.A.
Freeze Point, °C:	N.D.	Viscosity:	N.D.
Solubility in Water:	Slight	Partition Coefficient, n-octanol/	
Decompostion Temp., °C:	N.D.	water:	N.D.
Boiling Range, °C:	135 - 537	Explosive Limits, vol%:	0.9 - 10.5
Flammability:	Supports Combustion	Flash Point, °C:	41
Evaporation Rate:	Slower than Ether	Auto-ignition Temp., °C:	N.D.
Vapor Density:	Heavier than Air	Vapor Pressure:	N.D.

(See "Other information" Section for abbreviation legend)

10. Stability and Reactivity

CONDITIONS TO AVOID: Avoid contact with strong acid and strong bases. Avoid all possible sources of ignition.

INCOMPATIBILITY: Incompatible with strong oxidizing agents, strong acids and strong alkalies.

HAZARDOUS DECOMPOSITION: By open flame, carbon monoxide and carbon dioxide. When heated to decomposition, it emits acrid smoke and irritating fumes.

HAZARDOUS POLYMERIZATION: Will not occur under normal conditions.

STABILITY: This product is stable under normal storage conditions.

11. Toxicological information

EFFECTS OF OVEREXPOSURE - EYE CONTACT: Causes eye irritation. Irritating, and may injure eye tissue if not removed promptly.

EFFECTS OF OVEREXPOSURE - SKIN CONTACT: May cause skin irritation. Low hazard for usual industrial handling or commercial handling by trained personnel.

EFFECTS OF OVEREXPOSURE - INHALATION: Harmful if inhaled. High gas, vapor, mist or dust concentrations may be harmful if inhaled. Avoid breathing fumes, spray, vapors, or mist. May cause headaches and dizziness. High vapor concentrations are irritating to the eyes, nose, throat and lungs.

EFFECTS OF OVEREXPOSURE - INGESTION: Substance may be harmful if swallowed. Aspiration hazard if swallowed; can enter lungs and cause damage.

EFFECTS OF OVEREXPOSURE - CHRONIC HAZARDS: Reports have associated repeated and prolonged occupational overexposure to solvents with permanent brain and nervous system damage. IARC lists Ethylbenzene as a possible human carcinogen (group 2B).

PRIMARY ROUTE(S) OF ENTRY: Eye Contact, Ingestion, Inhalation, Skin Absorption, Skin Contact

ACUTE TOXICITY VALUES

The acute effects of this product have not been tested. Data on individual components are tabulated below:

CAS-No.	Chemical Name	Oral LD50	Dermal LD50	Vapor LC50
98-56-6	1-Chloro-4-(Trifluoromethyl)Benzene	13000 mg/kg Rat	>2684 mg/kg Rabbit	33 mg/L Rat
64742-49-0	Naphtha, Petroleum, Hydrotreated Light	>5000 mg/kg Rat	>3160 mg/kg Rabbit	>4951 mg/L Rat
64742-88-7	Mineral Spirits	>5000 mg/kg Rat	3000 mg/kg Rabbit	4951 mg/L Rat
96-29-7	Methyl Ethyl Ketoxime	930 mg/kg Rat	1100 mg/kg Rabbit	>4.8 mg/L Rat
100-41-4	Ethylbenzene	3500 mg/kg Rat	15400 mg/kg Rabbit	17.2 mg/L Rat

N.I. - No Information

12. Ecological Information

ECOLOGICAL INFORMATION: Product is a mixture of listed components. Product is a mixture of listed components.

13. Disposal Information

DISPOSAL INFORMATION: Dispose of material in accordance to local, state, and federal regulations and ordinances. Do not allow to enter waterways, wastewater, soil, storm drains or sewer systems.

14. Transport Information

	Domestic (USDOT)	International (IMDG)	<u>Air (IATA)</u>	<u>TDG (Canada)</u>
UN Number:	N.A.	1263	1263	N.A.
Proper Shipping Name:	Not Regulated	Paint and Related Products	Paint and Related Products	Not Regulated
Hazard Class:	N.A.	3	3	N.A.
Packing Group:	N.A.	III	III	N.A.
Limited Quantity:	No	Yes	Yes	No

15. Regulatory Information

U.S. Federal Regulations:

CERCLA - SARA Hazard Category

This product has been reviewed according to the EPA 'Hazard Categories' promulgated under Sections 311 and 312 of the Superfund Amendment and Reauthorization Act of 1986 (SARA Title III) and is considered, under applicable definitions, to meet the following categories:

Fire Hazard, Acute Health Hazard, Chronic Health Hazard

Sara Section 313:

This product contains the following substances subject to the reporting requirements of Section 313 of Title III of the Superfund Amendment and Reauthorization Act of 1986 and 40 CFR part 372:

Chemical Name	CAS-No.
Ethylbenzene	100-41-4

Toxic Substances Control Act:

This product contains the following chemical substances subject to the reporting requirements of TSCA 12(b) if exported from the United States:

<u>Chemical Name</u>	<u>CAS-No.</u>
1-Chloro-4-(Trifluoromethyl)Benzene	98-56-6
n-Nonane	111-84-2

16. Other Information

HMIS RAT Health:	FINGS 2*	Flammability:	2	Physical Hazard:	0	Personal Protection: X	
NFPA RA [:] Health:	TINGS 2	Flammability:	2	Instability	0		
VOLATILE	ORGA	NIC COMPOUN	DS, g/L:	259			
SDS REVI	SION D	ATE:	11/23/2015				
02 - Haza 03 - Com 09 - Phys 11 - Toxic 15 - Regu Substance Substance			02 - Hazard Id 03 - Composi 09 - Physical 11 - Toxicolog 15 - Regulato Substance Ha	tion/Information on Ingree & Chemical Properties gical Information ry Information Izard Threshold % Chang gulatory CAS Number Cl	dients		

Legend: N.A. - Not Applicable, N.E. - Not Established, N.D. - Not Determined

Rust-Oleum Corporation believes, to the best of its knowledge, information and belief, the information contained herein to be accurate and reliable as of the date of this safety data sheet. However, because the conditions of handling, use, and storage of these materials are beyond our control, we assume no responsibility or liability for personal injury or property damage incurred by the use of these materials. Rust-Oleum Corporation makes no warranty, expressed or implied, regarding the accuracy or reliability of the data or results obtained from their use. All materials may present unknown hazards and should be used with caution. The information and recommendations in this material safety data sheet are offered for the users' consideration and examination. It is the responsibility of the user to determine the final suitability of this information and to comply with all applicable international, federal, state, and local laws and regulations.